29-669



Suzuki steering wheel control interface

Supported functions

Volume up

Volume down

Seek/track up

Seek/track down

Source

Mute

Phone answer*

Phone reject*

Phone voice*



Connection instructions

Connect the head unit specific patch lead to the interface first. If using a universal patch lead, check it is setup correctly. Refer to the diagrams overleaf to check the patch lead is correct.

Connect the ISO connectors and patch lead to the new head unit.

Connect the 29-669 harness to the vehicle harness.

Test the steering controls.

Fit the head unit into place and test the steering controls again.

Notes

* Vehicles with phone buttons

29-669



Suzuki steering wheel control interface

Supported functions

Volume up

Volume down

Seek/track up

Seek/track down

Source

Mute

Phone answer*

Phone reject*

Phone voice*



Connection instructions

Connect the head unit specific patch lead to the interface first. If using a universal patch lead, check it is setup correctly. Refer to the diagrams overleaf to check the patch lead is correct.

Connect the ISO connectors and patch lead to the new head unit.


Connect the 29-669 harness to the vehicle harness.

Test the steering controls.

Fit the head unit into place and test the steering controls again.

Notes

* Vehicles with phone buttons

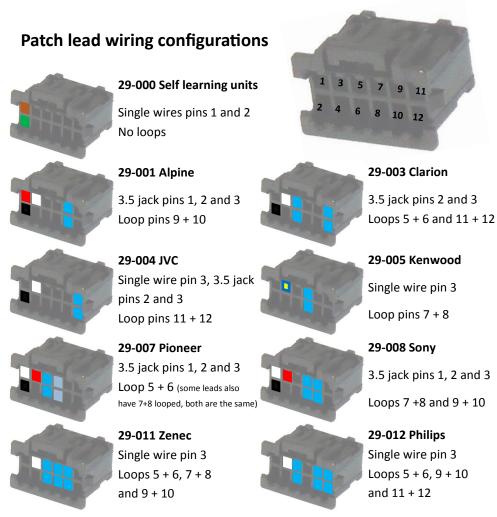

Troubleshooting

Radio not turning on

Check there is an ignition power supply to the new head unit and the interface.


Steering controls not working

Check the patch lead is correct and was connected to the interface before the interface was connected to the vehicle.

Reset the interface by completely disconnecting, wait for 2 minutes, then reconnect.

Check the wires in the harness are matching wires in the car.

Check the interface has software version SUZ01 V2.36 or newer.

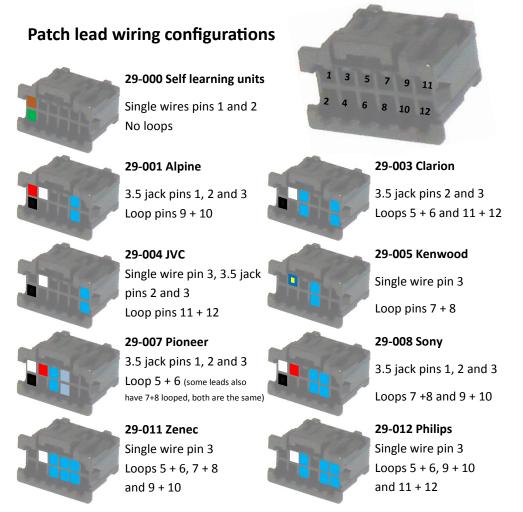

Troubleshooting

Radio not turning on

Check there is an ignition power supply to the new head unit and the interface.

Steering controls not working

Check the patch lead is correct and was connected to the interface before the interface was connected to the vehicle.

Reset the interface by completely disconnecting, wait for 2 minutes, then reconnect.

Check the wires in the harness are matching wires in the car.

Check the interface has software version SUZ01 V2.36 or newer.